

Make: FCC
Serial Number: BF
Model: RV000042S
VIN: 4UZAB2DT2BCBF
Production Date: 2/24/2011



PartsPro-Major Components

Site ID: w26102 USER ID:

ITEM	DESCRIPTION	MFR	MODEL	SERIAL NO.	COMPONENT P / N
03	ENGINE EPA10 - SERVICE DOCUMENTATION FOR THE AFTER TREATMENT DEVICE (ATD) IS DOCUMENTED WITHIN THE ENGINE SERIAL NUMBER.	CUM	ISB10 - EPA10	73199415	C01-00194-092
07	MAIN TRANSMISSION SEE MODULE 342 FOR TRANSMISSION OPTIONS	ALI	2500 MH	6311036761	C07-00028-205
21	FRONT AXLE FORWARD OR SINGLE	MBA	F105-3N	739912-A285616	C10-00001-006
23	REAR AXLE FORWARD OR SINGLE RATIO - 4.78	MBA	R175-2N	742820-A128318	C11-00002-000
31	BODY	028		Unknown	681 000 19 N1



Information displayed in this cross-reference table applies to the major components installed in this vehicle at the time it was originally built.

Printed on: Tuesday, July 23, 2013 3:58:27 PM


Make: FCC
Serial Number: BF
Model: RV000042S
Production Date: 2/24/2011
BOM: 622-C12611
BOM Description: SUSPENSION-REAR AXLE
Art ID: M622_320172



PartsPro-BOM-PartsList (Footnotes)

Site ID: w26102

USER ID:

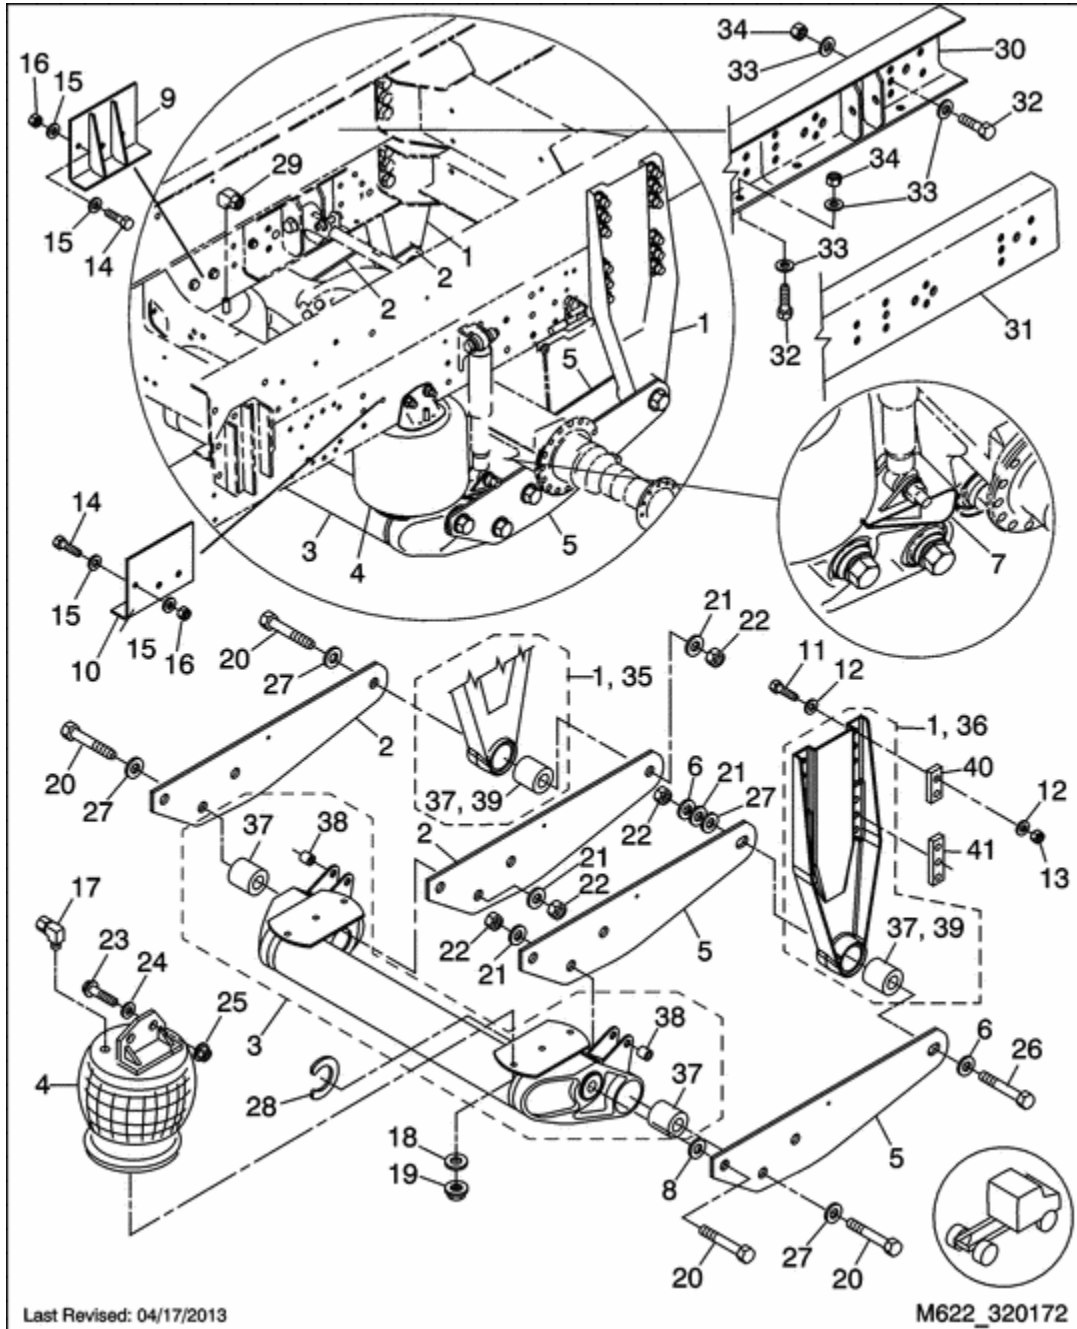

Make: FCC
 Serial Number: BF
 Model: RV000042S
 Production Date: 2/24/2011
 BOM: 622-C12611
 BOM Description: SUSPENSION-REAR AXLE



PartsPro-BOM-PartsList (Footnotes)

Site ID: w26102 USER ID:

REF	AD	PART NUMBER	ALT PART NUMBER	DESCRIPTION	UM	QTY
001		NEW 90521740		BRKT-FRAME,RSUSP,ADL,RRAIL	EA	2
037		HLD 90008211		:BUSHING-BRKT FRAME, RUBBER	EA	1
002		NEW 90034563		BEAM-RSUSP,ADL,FIXED	EA	2
003		NEW 90548516		ASSY-BEAM,TRNSVRSE,ADL,	EA	1
037		HLD 90008211		:BUSHING-BRKT FRAME, RUBBER	EA	2
038		HLD 90008241		:BUSHING-BEAM TRANSVERSE	EA	2
004		NEW 90557290		SPRING-AIR,RSUSP,ADL	EA	2
005		NEW 90034561		BEAM-RSUSP,ADL,ADJ	EA	2
006		NEW 90008242		WASHER-ALIGNMENT,ADL	EA	2
007		NEW 90045456		SHEILD-DEBRIS,ADL	EA	2
009		A16-19209-000 ASSY		-REINF,FRAME,XCL,LH	EA	1
010		A16-18507-000 ASSY		-REINF,FRAME,RH	EA	1
011		23-11755-225 SCR		EW-CAP,HEX,5/8-11 UNC	EA	24
012		23-09114-000 W		SHR-HRDN,0.69X1.31X.177,ZN	EA	48
		5/8 BEARING WASHER				
013		23-13833-110 N		UT-HEX,PT,5/8-11,C,ZN/AL,.559	EA	24
014		23-11751-150 SCR		EW,CAP,HEX,1/2-13,GR8,ZNDI	EA	2
015		23-09114-003 W		ASHER-HRDN,0.53X1.06X.177,ZN	EA	4
		1/2 BEARING WASHER				
016		23-13833-108 N		UT-HEX,PT,1/2-13,C,ZN/AL,.448	EA	2
017		SMC KV2L07 35S		ELB-90,1/4PC+1/4MPT,GRY	EA	1
018		23-09114-003 W		ASHER-HRDN,0.53X1.06X.177,ZN	EA	2
		1/2 BEARING WASHER				
019		23-13833-108 N		UT-HEX,PT,1/2-13,C,ZN/AL,.448	EA	2
020		23-09452-650 SCR		EW-CAP,HEX,1 1/8-7,GR8	EA	7
022		GAF 48620AX		NUT-HEX,LKG,1 1/8-7,CD,GR8	EA	8
023		23-11755-175 SCR		EW-CAP,HEX,5/8-11 UNC	EA	4
024		23-09114-000 W		SHR-HRDN,0.69X1.31X.177,ZN	EA	8
		5/8 BEARING WASHER				
025		23-13833-110 N		UT-HEX,PT,5/8-11,C,ZN/AL,.559	EA	4
026		23-09452-700 SCR		EW-CAP,HEX,1 1/8-7,GR8	EA	1
027		23-09114-009 W		ASHER-HRDN,1.25X2.25X.177,ZN	EA	16
028		NEW 90036249		WASHER-SPACER,ADL	EA	2
		SMC KV2T07 35S		T,BRC,1/4MPT+1/4PC+1/4PC,GRY	EA	1

Make: FCC
Serial Number: BF
S
Production Date: 2/24/2011
BOM: 622-C12611
BOM Description: SUSPENSION-REAR AXLE



PartsPro-BOM-PartsList (Footnotes)

Site ID: w26102


USER ID:

REF	AD	PART NUMBER	ALT PART NUMBER	DESCRIPTION	UM	QTY
		D16-19135-001 I		NSTL-SUSP,ADL,XCR,XBR	EA	R
		D16-18081-000 I		NSTL-FRAME,REINF	EA	AR

Printed on: Tuesday, July 23, 2013 4:10:28 PM



Site ID: w26102 USER ID:



Make: FCC
 Serial Number: BF
 Model: RV000042S
 Production Date: 2/24/2011
 BOM: 439-C01708
 BOM Description: SHOCK ABSORBER-REAR



PartsPro-BOM-PartsList (Footnotes)

Site ID: w26102

USER ID:

REF	AD	PART NUMBER	ALT PART NUMBER	DESCRIPTION	UM	QTY
001		16-16736-000 SHOCK,SAC,3		43/523,19/45,ADL	EA	2
002		GAF P114779		BRKT-SHOCK MOUNT,UPR	EA	2
003		23-11751-175 SCR		EW,CAP,HEX,1/2-13,GR8,ZNDI	EA	2
004		23-11757-400 SCR		EW-CAP,HEX,3/4-10,GR8,ZN	EA	2
005		23-09114-003 W		ASHER-HRDN,0.53X1.06X.177,ZN	EA	8
		1/2 BEARING WASHER				
006		23-09114-004 3	/4 WASHER	WASHER-HRDN,0.81X1.47X.177,ZN	EA	8
007		23-13175-108 N		UT-HEX,PT,1/2-13,C,CD,.448	EA	4
008		23-13175-112 N		UT-HEX,LKG,3/4-10,GR8,CD	EA	4
009		23-11751-200 SCR		EW,CAP,HEX,1/2-13,GR8,ZNDI	EA	2
010		23-11757-350 SCR		EW-CAP,HEX,3/4-10,GR8,ZN	EA	2
		D16-16735-000 I		NSTL-SUSP,ADL,R/RAIL	EA	AR

Printed on: Tuesday, July 23, 2013 4:08:29 PM


Make: MBA
Series: 742820-A128318
Model: R175-2N
2/8/2011
BOM: C11-00002-000
BOM Description: MBA R175-2N, R, C6,1384.4,RE
Art ID: A420_000007AB



PartsPro-BOM-PartsList (Footnotes)

Site ID: w26102

USER ID:

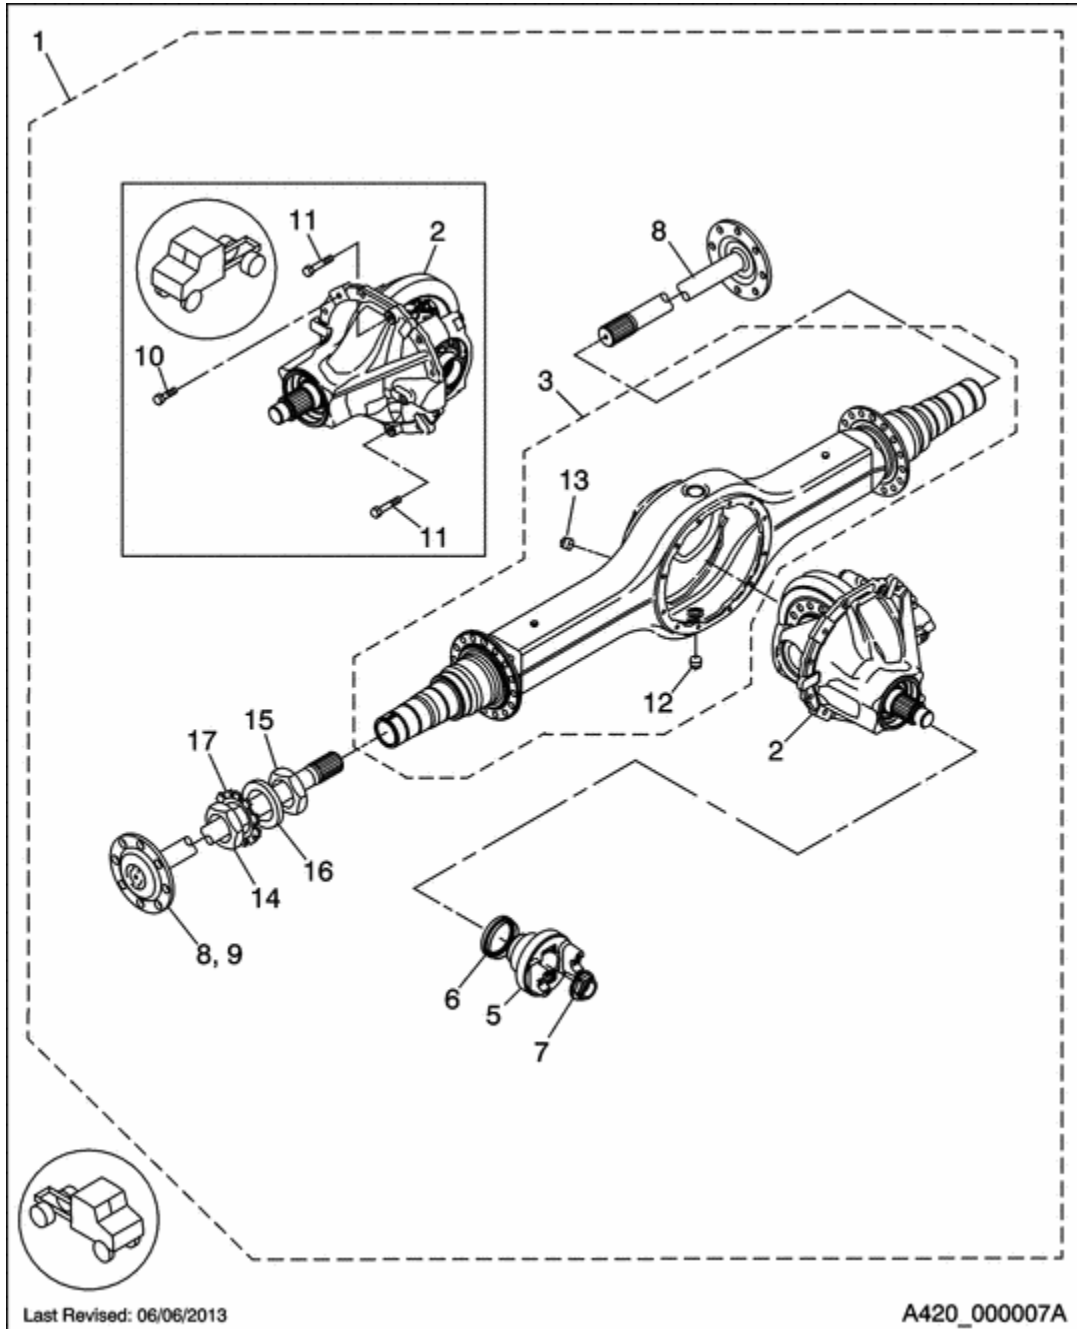

Make: MBA
Series: 742820-A128318
Model: R175-2N
 2/8/2011
BOM: C11-00002-000
BOM Description: MBA R175-2N, R, C6,1384.4,RE



PartsPro-BOM-PartsList (Footnotes)

Site ID: w26102

USER ID:

REF	AD	PART NUMBER	ALT PART NUMBER	DESCRIPTION	UM	QTY
002		MBA 6073504503E		:NEW CARRIER, R2, 4.78	EA	1
003		MBA 6803501730		:AXLE HOUSING	EA	1
012		MBA 6803570089		::OIL DRAIN PLUG-MAGNETIC	EA	1
013		MBA 6809900017		::OIL FILL PLUG-SQUARE INSIDE	EA	1
005		MBA 6803500044		:ZB YOKE 1710	EA	1
006		MBA 0249978047		:RADIAL SHAFT SEAL	EA	1
007		MBA 3853510172		:NUT-12 PT.,INPUT YOKE	EA	1
008		MBA 6803570401		:AXLE SHAFT, LH	EA	1
009		MBA 6803570501		:AXLE SHAFT, RH	EA	1
010		MBA 0109904001		:SCREW-M12X1X40,SHORT	EA	10
011		MBA 0109904101		:SCREW-M12X1X60,LONG	EA	2
121		MBA 6073500023K		::DIFF REPAIR KIT, R2	EA	1
122		MBA 6803530025		::THREADED RING M115 R2	EA	1
123		MBA 0179818005		::BEARING (70X110X25) R2	EA	1
124		MBA 6803530001		::DIFFERENTIAL HOUSING	EA	1
125		MBA 000000005546		::BOLT M16 X 1.5 X 110	EA	2
127		MBA 6809900601		::SET SCREW M6 X 16 W/NYLON	EA	2
128		MBA 0179817905		::BEARING (100X150X32) R2	EA	1
129		MBA 6803530125		::THREADED RING M155 R2	EA	1
131		MBA 6073501239K		::RING GEAR BOLT KIT R2	EA	1
132		MBA 6073500049K		::PINION BEARING KIT R2	EA	1
133		MBA 6073500839K		::GEARSET I=4.778- R2	EA	1
140		MBA 6743530091		::COVER, RADIAL SEAL	EA	1

Printed on: Tuesday, July 23, 2013 4:03:11 PM


Make: FCC
Serial Number: BF
Model: RV000042S
Production Date: 2/24/2011
BOM: 441-C01312
BOM Description: REAR AXLE ACCESSORIES
Art ID: M441_350002



PartsPro-BOM-PartsList (Footnotes)

Site ID: w26102

USER ID:

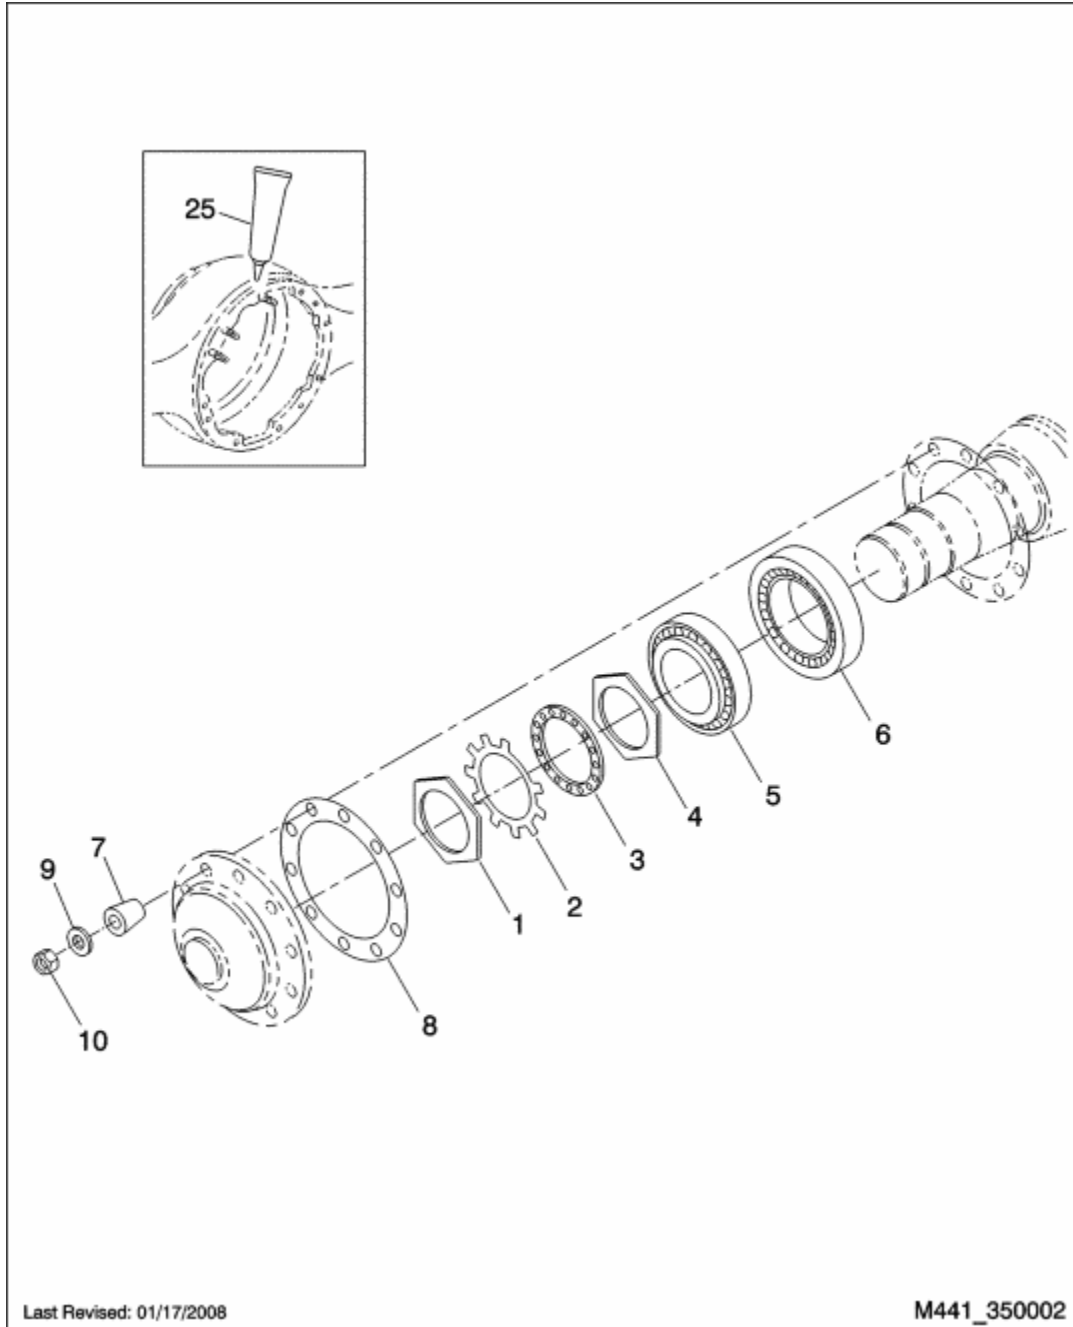

Make: FCC
 Serial Number: BF
 Model: RV000042S
 Production Date: 2/24/2011
 BOM: 441-C01312
 BOM Description: REAR AXLE ACCESSORIES



PartsPro-BOM-PartsList (Footnotes)

Site ID: w26102

USER ID:

REF	AD	PART NUMBER	ALT PART NUMBER	DESCRIPTION	UM	QTY
001		FXA 119881		NUT-BRNG,OUTER,3.25-12UN ,4.00	EA	2
002		FXA 129132		WASHER-TANGED ,3.29,R ,KW	EA	2
003		FXA 119883		WASHER-PIERCED,3.29,R ,KW,4.35	EA	2
004		FXA 119882		NUT-BRNG,INNER,3.25-12UN ,4.00	EA	2
005		SBN 580	SBN 580TRB	CONE-BRG 3.250 1.437 572	EA	2
006		SBN 594A	SBN 594ATRB	CONE-BRG 3.750 1.562 592A	EA	2
007		TDA 1246V1166		DOWEL-AXL SHFT,SOLID,.629,26DG	EA	16
008		11-14418-000 G		SKT,AXL SHFT,7.00, 8,.66,.016	EA	2
009		23-09114-010 W		ASHER-HRDN,0.69X0.94X.117,ZN	EA	16
010		23-09247-210 N		UT-HEX,5/8-18,GR8,PO	EA	16
025		TDA 2297A7021		SEALANT GASKET-CARRIER/HOUSING	EA	AR
		K09-S0011-001 B		EARING ADJUSTMENT,WHEEL	EA	R
		D11-19902-000		NUTS, 4-PIECE, 1/8 TURN	EA	R
		681 356 05 A1		INSTL-AXLE,RR DRV,SPOKE	EA	R

Printed on: Monday, July 29, 2013 7:45:57 AM